# TAKEX

**PHOTOSENSOR** (with built-in amplifier)

middle-G SERIES Instruction Manual

TAKENAKA ELECTRONIC INDUSTRIAL CO.,LTD.

: 20-1 Narano-cho, Shinomiya, Yamashina-ku, : Kyoto 607-8032, Japan : +81-75-581-7111 : +81-75-581-7118

Telephone FAX

- Thank you for using TAKEX products.
- Please read this manual carefully prior to sensor use.

## SPECIFICATIONS

# CE

Retro-reflection reflection beam Retro-reflection reflection	GSZ5RPN **GSZ5RSPN-J				
Models         Basic         GT5RN         GMR2RN         GSR05RN         GSZ5R         GT5RPN-N         GMR2RPN-N         GSR05RPN-N           Connector Models         Side-on         GT5RSN-J         GMR2RSN-J         GSR05RSN-J         #GSZ5RS-J         GT5RSPNN-J         GMR2RSPNN-J         GSR05RSPNN-J           Detection method         Throughbeam         Polarized Retro-reflection         Diffuse reflection         Convergent beam         Throughbeam         Polarized Retro-reflection         Diffuse reflection         Throughbeam         Polarized Retro-reflection         Diffuse Retro-reflection         Throughbeam         Polarized Retro-reflection         Throughbeam         Diffuse Retro-reflection         Throughbeam         Toloy	GSZ5RPN  **GSZ5RSPN-J  **GSZ5RPN-J  Convergent beam				
Connector Models	*GSZ5RSPN-J *GSZ5RPN-J Convergent beam				
	*GSZ5RPN-J Convergent beam				
	Convergent beam				
Retro-reflection reflection beam reflection	beam				
Object resolution Opaque object 100×100mm	20~50mm				
Object resolution Opaque object 100×100mm					
Power supply 12 - 24\/ DC ± 100\/ Bipple 100\/ (may.)					
Fower supply					
Current consumption         Trns : 20mA Rcvr : 20mA         30mA         25mA         Trns : 20mA Rcvr : 25mA         35mA	30mA				
	Source current: 100mA, 30VDC (max.)				
output Sink current : 50mA, 30VDC (max.) Source current : 50mA, 30VDC					
Operating mode Light/Dark-On selectable					
Residual Voltage 1V (max.) 2V (max.)					
Response time 0.5 ms (max.)					
	O° (Rcvr) 30° (Reflector) ———				
Hysteresis — 10% (max.) — 10% (	(max.)				
Light source Red LED (700nm)					
Tms:	Operation (Red)				
Operation (Red) Tolerance (Green) Operation (Red) Tolerance (Green) Tolerance (Green)	Tolerance (Green)				
Volume (VR) SENS : sensitivity VR	SENS : sensitivity VR				
Switch (SW) Light-on / Dark-on selectable switch	Light-on / Dark-on selectable switch				
Short protection Built-in	Built-in				
Material Case: Polyarylate Lens: Acrylic					
Connection	Flying lead ( \$4.2) Through-beam Transmitter 0.3mm²×2 2m (Glay) Through-beam Receiver 0.2mm²×4 2m (Black)				
Connector M8 connector					
	Approx. 80g				
	9 g Approx. 25g Reflector K-71				
Connector Irns: 259 Approx. 259 Rcvr: 259 Approx. 259 Approx. 259					

## CONNECTOR TYPE "-J"

(-J: Quick disconnect type M8, 4 pin)

Available receptacle cables as an option.

· Straight type: FBC-4R2S (2m length)

· Langle type: FBC-4R2L (2m length)

\* : Models followed by \* are discontinued.
For the Polarized Retro-reflection type, the figures show the installation range of the reflector.
The range and the object resolution differs according to the

reflector to be used.


Perform detection test by using actual object to be detected.

The detection distance of diffuse-reflective type sensor differs largely depending on the light permeability of the object.


#### **USABLE AMBIENT CONDITIONS**

Ambient light	Withstands 5,000 l x (max.)			
Operating temp	-25 to +55℃			
Ambient humidity	35 to 85%RH			
Protection	I P67			
Vibration	10~55Hz 1.5mm Amplitude 2h., 3 Directions			
Dielectric Withstanding	AC1000V 1 min.			
Insulation resistance	20MΩ min. at 500VDC			
Shock	500 m/s <sup>2</sup> 3 times, 3 directions			


#### **OUTPUT CIRCUIT**

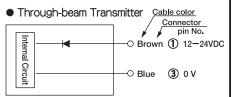

#### NPN output

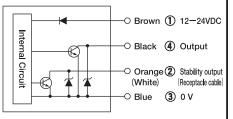


### PNP output

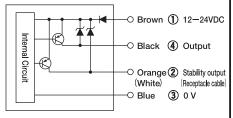

- Loaded short circuit or overlord shuts off the output transistor.
- Turn the power back on after checking the loaded condition.
- When the stability output (orange cable) or white cable) in not used, do not connect other lines or take the insulation processing of the cable.

#### (Connector type Pin No.)




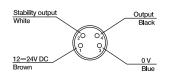

- The figure shows cable color for the optional cable with M8 connector which is sold seperately.
- Transmitter of Throughbeam type uses Brown: 12-24VDC and Blue: 0V only.

### **OPERATING MODE**

• All types are equipped with Light/Dark-ON selectable switch.

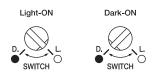


Light-ON Position (L) Dar

Dark-ON Position (D)

#### INDICATOR

 Operating indicator : Red. Stability indicator : Green.

 Confirm to get stable light capacity by repeating of light-on and dark-on after adjustment of light axis and sensitivity.

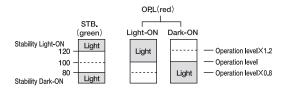

 $\cdot$  Red LED of receiver means the operating indicator. In case it's L.ON (Light-on), this indicator lights when receiver the LED.


In case it's D.ON (Dark-on), this indicator lights when shutting the LED.

Light-on and Dark-on after adjustment of light axis and sensitivity.

# HOW TO USE STABILITY OUTPUT

This stability output is suitable for confirmation of misalignment of the light axis, decreasing in the quantity of received light and alternation of environment after installation.

If the quantity of received light do not reach within the stable range (per 120%), it will be output.

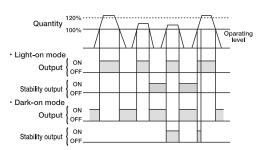

### **ADJUSTMENT**

# (1) Throughbeam Type

 Adjust the axis of transmitter at the position where the lens surface of receiver becomes reddest by swinging out the light source up/down and right/left direction.



 Adjust receiver to the center of range by swinging out up/down, right/left.


Confirm the green LED Lights.

Red LED (OP.L) is operation indicator.

Selectable Light/ON/Dark-ON.

#### (2) Polarized Retro-reflection Type

Set the polarized reflector (mirror) and sensor.
 Adjust the axis at the position where the mirror becomes red shiny.

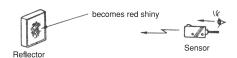

- 2 Set the sensitivity adjuster (SENS.) to MAX.
- ③ Turn the SENS. counterclockwise in case that target object such as translucence object blocks the axis.
- The range depends on reflector type.

Reflector Type	K-71	K-7	S-25
Range	0.03~1.5m	0.03~2.5m	70~400mm

#### (3) Diffuse reflection Type (LIGHT-ON Operation)

- In case of reflective background
- ① Set a target object to the desired position and then increase the sensitivity adjustment gradually from the minimum position until the indicator LED is on (Point A).
- ② Remove the target object and gradually decrease the sensitivity adjustment from the maximum position until the LED is off (Point B). If the LED is still off even though the potentiometer is at the maximum position, this maximum position should be the point B.
- ③ Set the potentiometer at the center between Point A and B.
- SENS.


  A

  MIN. SENS.
- ◆ In case of no-reflective background
- ① Point A is the same point mentioned above.
- ② Set the potentiometer at the center between Point A and MAX.
  - Confirm both of red LED and green LED light.



#### **NOTES**

- Use a dry, soft cloth for cleaning the lens and case and lightly wipe it off. Never use solvents such as thinner or alcohole.
- Use power supply and voltage in the specification range.
- Never cycle on/off continually.
- Don't use the sensor where direct water spray continuously occurs, or under water although this sensor is waterproof (IP67).
- When a commercial available switching regulator is used, ground the FG (frame ground) terminal.
- Sole wiring through metal tube is required by high power or voltage line.
- Tightening torque is within 0.6N·m when mounting by screw.

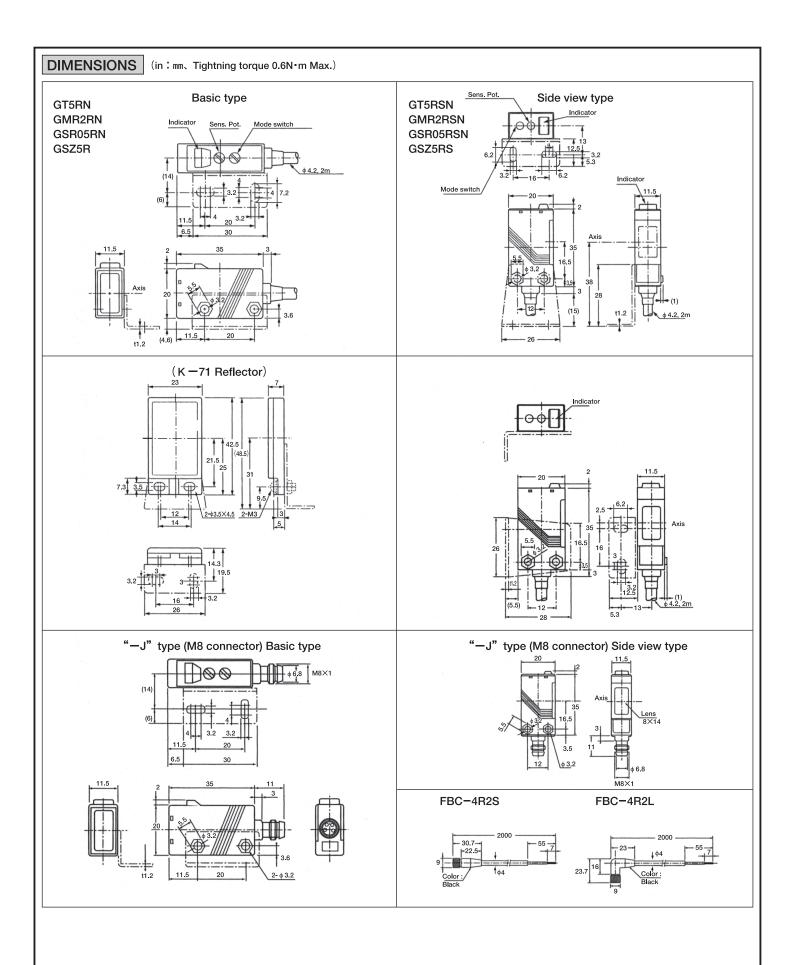

- This sensor is designed to detect a specific object. It is not provided with control functions for prevention of injuries or accidents in itself.
- Takex will not held responsible for any damage or loss incurred due to accidents, faulty installation, abuse, misuse, improper maintenance or acts of God including lightning surge.
- Specifications and dimensions may be subject to change without notice.